

Pressure Systems, Inc.
Esterline Corporation
34 Research Drive
Hampton, VA 23666

Tel: 757-865-1243
Fax: 757-766-2644
www.PressureSystems.com
NYSE symbol: ESL

Recovering From Firmware Upgrade Errors

If a firmware upgrade process is interrupted before completion, your transducer will be left in a state where it is unable to operate in a normal manner. If your transducer is left in this mode, use the following steps to enable the transducer's boot loader and download valid firmware into your unit.

- Remove external power from your waterMONITOR cable.
- Go to the firmware download function by selecting **Configure | Update Firmware**.
- Select the proper firmware download file using the **Browse** button.
- Start the download process by clicking the **Update** button.
- K-ware will not be able to start the firmware download since the waterMONITOR contains previously corrupted firmware. While K-ware is trying to start the download process, briefly short together the power input terminals of your cable.
- The firmware download process should begin after the power terminals are shorted. Allow the download to complete.